



Shoulder Screws - Cap Head

hex drive - 303 stainless, blackened


Shoulder Screws



MADE IN
BRITAIN

36642.B2

SHOULDER SCREWS

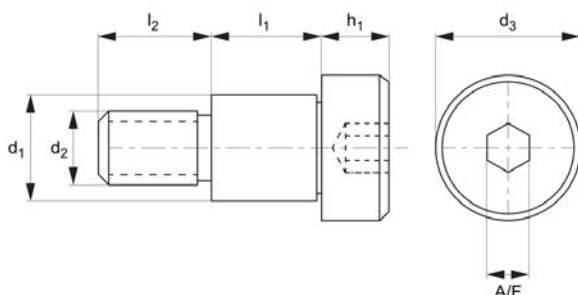

Material

Stainless steel (AISI 303, 1.4305), black oxide coating. Tensile strength 550 N/mm². Proof stress min. 190 N/mm², austenitic stainless steel.

Technical Notes

303 series stainless steel provides good resistance to corrosion. It is mildly magnetic.
For torx drive versions please see 33658.

Special lengths and diameters produced to drawings.

Order No.	d ₁ +0 -0.025	l ₁ +0.05 -0.0	d ₂	d ₃	l ₂	h ₁	A/F
36642.W0302-B2	3	2	M 2	5	4	2	1.5
36642.W0303-B2	3	3	M 2	5	4	2	1.5
36642.W0304-B2	3	4	M 2	5	4	2	1.5
36642.W0305-B2	3	5	M 2	5	4	2	1.5
36642.W0306-B2	3	6	M 2	5	4	2	1.5
36642.W0307-B2	3	7	M 2	5	4	2	1.5
36642.W0308-B2	3	8	M 2	5	4	2	1.5
36642.W0310-B2	3	10	M 2	5	4	2	1.5
36642.W0312-B2	3	12	M 2	5	4	2	1.5
36642.W0314-B2	3	14	M 2	5	4	2	1.5
36642.W0316-B2	3	16	M 2	5	4	2	1.5
36642.W0318-B2	3	18	M 2	5	4	2	1.5
36642.W0320-B2	3	20	M 2	5	4	2	1.5
36642.W0325-B2	3	25	M 2	5	4	2	1.5
36642.W0402-B2	4	2	M 3	6	4	3	2.0
36642.W0403-B2	4	3	M 3	6	4	3	2.0
36642.W0404-B2	4	4	M 3	6	4	3	2.0
36642.W0405-B2	4	5	M 3	6	4	3	2.0
36642.W0406-B2	4	6	M 3	6	4	3	2.0
36642.W0407-B2	4	7	M 3	6	4	3	2.0
36642.W0408-B2	4	8	M 3	6	4	3	2.0
36642.W0410-B2	4	10	M 3	6	4	3	2.0
36642.W0412-B2	4	12	M 3	6	4	3	2.0
36642.W0414-B2	4	14	M 3	6	4	3	2.0
36642.W0416-B2	4	16	M 3	6	4	3	2.0
36642.W0418-B2	4	18	M 3	6	4	3	2.0
36642.W0420-B2	4	20	M 3	6	4	3	2.0
36642.W0425-B2	4	25	M 3	6	4	3	2.0
36642.W0430-B2	4	30	M 3	6	4	3	2.0
36642.W0435-B2	4	35	M 3	6	4	3	2.0
36642.W0440-B2	4	40	M 3	6	4	3	2.0
36642.W0445-B2	4	45	M 3	6	4	3	2.0
36642.W0450-B2	4	50	M 3	6	4	3	2.0



Order No.	d_1 +0 -0.025	l_1 +0.05 -0.0	d_2	d_3	l_2	h_1	A/F
36642.W0502-B2	5	2	M 4	8	5	4	2.5
36642.W0503-B2	5	3	M 4	8	5	4	2.5
36642.W0504-B2	5	4	M 4	8	5	4	2.5
36642.W0505-B2	5	5	M 4	8	5	4	2.5
36642.W0506-B2	5	6	M 4	8	5	4	2.5
36642.W0507-B2	5	7	M 4	8	5	4	2.5
36642.W0508-B2	5	8	M 4	8	5	4	2.5
36642.W0510-B2	5	10	M 4	8	5	4	2.5
36642.W0512-B2	5	12	M 4	8	5	4	2.5
36642.W0514-B2	5	14	M 4	8	5	4	2.5
36642.W0516-B2	5	16	M 4	8	5	4	2.5
36642.W0518-B2	5	18	M 4	8	5	4	2.5
36642.W0520-B2	5	20	M 4	8	5	4	2.5
36642.W0525-B2	5	25	M 4	8	5	4	2.5
36642.W0530-B2	5	30	M 4	8	5	4	2.5
36642.W0535-B2	5	35	M 4	8	5	4	2.5
36642.W0540-B2	5	40	M 4	8	5	4	2.5
36642.W0545-B2	5	45	M 4	8	5	4	2.5
36642.W0550-B2	5	50	M 4	8	5	4	2.5
36642.W0602-B2	6	2	M 5	10	6	5	3.0
36642.W0603-B2	6	3	M 5	10	6	5	3.0
36642.W0604-B2	6	4	M 5	10	6	5	3.0
36642.W0605-B2	6	5	M 5	10	6	5	3.0
36642.W0606-B2	6	6	M 5	10	6	5	3.0
36642.W0607-B2	6	7	M 5	10	6	5	3.0
36642.W0608-B2	6	8	M 5	10	6	5	3.0
36642.W0610-B2	6	10	M 5	10	6	5	3.0
36642.W0612-B2	6	12	M 5	10	6	5	3.0
36642.W0614-B2	6	14	M 5	10	6	5	3.0
36642.W0616-B2	6	16	M 5	10	6	5	3.0
36642.W0618-B2	6	18	M 5	10	6	5	3.0
36642.W0620-B2	6	20	M 5	10	6	5	3.0
36642.W0625-B2	6	25	M 5	10	6	5	3.0
36642.W0630-B2	6	30	M 5	10	6	5	3.0
36642.W0635-B2	6	35	M 5	10	6	5	3.0
36642.W0640-B2	6	40	M 5	10	6	5	3.0
36642.W0645-B2	6	45	M 5	10	6	5	3.0
36642.W0650-B2	6	50	M 5	10	6	5	3.0
36642.W0655-B2	6	55	M 5	10	6	5	3.0
36642.W0660-B2	6	60	M 5	10	6	5	3.0
36642.W0670-B2	6	70	M 5	10	6	5	3.0
36642.W0680-B2	6	80	M 5	10	6	5	3.0
36642.W0690-B2	6	90	M 5	10	6	5	3.0
36642.W0600-B2	6	100	M 5	10	6	5	3.0
36642.W0804-B2	8	4	M 6	12	11	6	4.0
36642.W0805-B2	8	5	M 6	12	11	6	4.0
36642.W0806-B2	8	6	M 6	12	11	6	4.0
36642.W0807-B2	8	7	M 6	12	11	6	4.0
36642.W0808-B2	8	8	M 6	12	11	6	4.0
36642.W0810-B2	8	10	M 6	12	11	6	4.0
36642.W0812-B2	8	12	M 6	12	11	6	4.0
36642.W0814-B2	8	14	M 6	12	11	6	4.0
36642.W0816-B2	8	16	M 6	12	11	6	4.0
36642.W0818-B2	8	18	M 6	12	11	6	4.0
36642.W0820-B2	8	20	M 6	12	11	6	4.0
36642.W0825-B2	8	25	M 6	12	11	6	4.0
36642.W0830-B2	8	30	M 6	12	11	6	4.0
36642.W0835-B2	8	35	M 6	12	11	6	4.0
36642.W0840-B2	8	40	M 6	12	11	6	4.0
36642.W0845-B2	8	45	M 6	12	11	6	4.0
36642.W0850-B2	8	50	M 6	12	11	6	4.0
36642.W0855-B2	8	55	M 6	12	11	6	4.0
36642.W0860-B2	8	60	M 6	12	11	6	4.0
36642.W0865-B2	8	65	M 6	12	11	6	4.0
36642.W0870-B2	8	70	M 6	12	11	6	4.0
36642.W0875-B2	8	75	M 6	12	11	6	4.0
36642.W0880-B2	8	80	M 6	12	11	6	4.0
36642.W0890-B2	8	90	M 6	12	11	6	4.0



Shoulder Screws - Cap Head

hex drive - 303 stainless, blackened

Shoulder Screws



Order No.	d_1 +0 -0.025	l_1 +0.05 -0.0	d_2	d_3	l_2	h_1	A/F
36642.W0800-B2	8	100	M 6	12	11	6	4.0
36642.W1008-B6	10	8	M 6	14	11	6	4.0
36642.W1010-B6	10	10	M 6	14	11	6	4.0
36642.W1012-B6	10	12	M 6	14	11	6	4.0
36642.W1016-B6	10	16	M 6	14	11	6	4.0
36642.W1008-B8	10	8	M 8	14	12	7	5.0
36642.W1010-B8	10	10	M 8	14	12	7	5.0
36642.W1012-B8	10	12	M 8	14	12	7	5.0
36642.W1014-B8	10	14	M 8	14	12	7	5.0
36642.W1016-B8	10	16	M 8	14	12	7	5.0
36642.W1018-B8	10	18	M 8	14	12	7	5.0
36642.W1020-B8	10	20	M 8	14	12	7	5.0
36642.W1025-B8	10	25	M 8	14	12	7	5.0
36642.W1030-B8	10	30	M 8	14	12	7	5.0
36642.W1035-B8	10	35	M 8	14	12	7	5.0
36642.W1040-B8	10	40	M 8	14	12	7	5.0
36642.W1045-B8	10	45	M 8	14	12	7	5.0
36642.W1050-B8	10	50	M 8	14	12	7	5.0
36642.W1055-B8	10	55	M 8	14	12	7	5.0
36642.W1060-B8	10	60	M 8	14	12	7	5.0
36642.W1065-B8	10	65	M 8	14	12	7	5.0
36642.W1070-B8	10	70	M 8	14	12	7	5.0
36642.W1080-B8	10	80	M 8	14	12	7	5.0
36642.W1090-B8	10	90	M 8	14	12	7	5.0
36642.W1000-B8	10	100	M 8	14	12	7	5.0
36642.W1208-B2	12	8	M 10	20	16	8	6.0
36642.W1210-B2	12	10	M 10	20	16	8	6.0
36642.W1212-B2	12	12	M 10	20	16	8	6.0
36642.W1214-B2	12	14	M 10	20	16	8	6.0
36642.W1216-B2	12	16	M 10	20	16	8	6.0
36642.W1218-B2	12	18	M 10	20	16	8	6.0
36642.W1220-B2	12	20	M 10	20	16	8	6.0
36642.W1225-B2	12	25	M 10	20	16	8	6.0
36642.W1230-B2	12	30	M 10	20	16	8	6.0
36642.W1235-B2	12	35	M 10	20	16	8	6.0
36642.W1240-B2	12	40	M 10	20	16	8	6.0
36642.W1245-B2	12	45	M 10	20	16	8	6.0
36642.W1250-B2	12	50	M 10	20	16	8	6.0
36642.W1255-B2	12	55	M 10	20	16	8	6.0
36642.W1260-B2	12	60	M 10	20	16	8	6.0
36642.W1265-B2	12	65	M 10	20	16	8	6.0
36642.W1270-B2	12	70	M 10	20	16	8	6.0
36642.W1275-B2	12	75	M 10	20	16	8	6.0
36642.W1280-B2	12	80	M 10	20	16	8	6.0
36642.W1290-B2	12	90	M 10	20	16	8	6.0
36642.W1200-B2	12	100	M 10	20	16	8	6.0
36642.W1625-B2	16	25	M 12	24	18	11	8.0
36642.W1630-B2	16	30	M 12	24	18	11	8.0
36642.W1635-B2	16	35	M 12	24	18	11	8.0
36642.W1640-B2	16	40	M 12	24	18	11	8.0
36642.W1645-B2	16	45	M 12	24	18	11	8.0
36642.W1650-B2	16	50	M 12	24	18	11	8.0
36642.W1655-B2	16	55	M 12	24	18	11	8.0
36642.W1660-B2	16	60	M 12	24	18	11	8.0
36642.W1665-B2	16	65	M 12	24	18	11	8.0
36642.W1670-B2	16	70	M 12	24	18	11	8.0
36642.W1675-B2	16	75	M 12	24	18	11	8.0
36642.W1680-B2	16	80	M 12	24	18	11	8.0
36642.W1690-B2	16	90	M 12	24	18	11	8.0
36642.W1600-B2	16	100	M 12	24	18	11	8.0
36642.W2030-B2	20	30	M 16	30	22	14	10.0
36642.W2035-B2	20	35	M 16	30	22	14	10.0
36642.W2040-B2	20	40	M 16	30	22	14	10.0
36642.W2045-B2	20	45	M 16	30	22	14	10.0
36642.W2050-B2	20	50	M 16	30	22	14	10.0
36642.W2055-B2	20	55	M 16	30	22	14	10.0
36642.W2060-B2	20	60	M 16	30	22	14	10.0
36642.W2065-B2	20	65	M 16	30	22	14	10.0

SHOULDER SCREWS



Order No.	d_1 +0 -0.025	l_1 +0.05 -0.0	d_2	d_3	l_2	h_1	A/F
36642.W2070-B2	20	70	M 16	30	22	14	10.0
36642.W2075-B2	20	75	M 16	30	22	14	10.0
36642.W2080-B2	20	80	M 16	30	22	14	10.0
36642.W2090-B2	20	90	M 16	30	22	14	10.0
36642.W2000-B2	20	100	M 16	30	22	14	10.0