


# **Vertical Acting Toggle Clamps** black - safety lever - open arm - horizontal base

# Optical Measuring Toggle



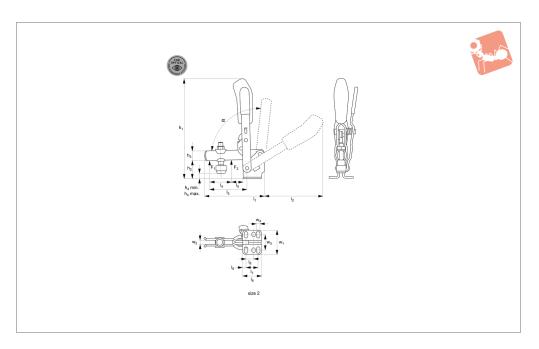

40010.2

### Material

Body: steel matt black.

Bushes: case hardened and pre-lubricated. Ergonomic soft feel, oil-resistant handle with large grip area.

Supplied complete with clamping screw (with rubber pad).

### **Technical Notes**

The safety lever holds the clamping arm in

both the clamped and open position. This prevents opening under vibration or accidental movement of the clamping arm during assembly/disassembly of the fixture.

Opening angle (symbola/symbol/symbola/ symbol\*) can be changed by pressing in a stop pin on the clamp body.

For optical analysis applications.

# Tips

Designed specifically for clamping of parts during photometric measurement. Uniform matt black surface prevents reflection, enabling easy "knocking-out" of the clamp during optical analysis of a component.

Order No.	Size	F <sub>1</sub>	F <sub>2</sub> kN	Clamping screw	$h_1$	h <sub>2</sub>	h <sub>3</sub>	h <sub>4</sub> min.	h <sub>4</sub> max.	$I_1$	l <sub>2</sub>	l <sub>3</sub>	Weight
40010.W0005	2	1.0	1.2	M 6x46	139	23	12	-4.4	4.4	78	88	52	260
Order No.	I <sub>4</sub>	I <sub>5</sub>	I <sub>6</sub>	I <sub>7</sub>	l <sub>8</sub>	l <sub>9</sub>	$w_1$	$W_2$	$w_3$		$d_1$	α	α*
40010.W0005	26	11	32	20	6	12.5	6	43	23-3	1	5.5	105°	60°



# **Wixroyd Toggle Clamps**

for optical measurement system



# Meeting the Needs of Component Clamping During Optical Measurements



The black toggle clamps are especially suited for optical workpiece measurements.

The complete matt-black surface of the clamps prevents reflections. As a result, in the later evaluation of the measurement results on the PC, all un-needed clamp parts can be "knocked out" and only the actual workpiece is visible.

These toggle clamps are blackened using the Vario-Spektrox® process. This offers effective protection against corrosion and film rust formation. In addition, this process is less environmentally damaging.

# **Component Clamping**

OPTICAL MEASURING TOGGLE CLAMPS




# **Optical Measurement Process**




# Marking and measuring

For overlaying of several pictures, circular markings are attached to the object. A stripe pattern is projected onto the object surface by a white-light projector and photographed by two cameras from different angles of view.

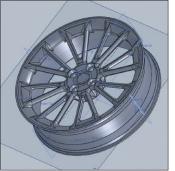

## **Evaluation**

Within seconds, highly precise 3D coordinates of up to 4 million object points per measurement are calculated. For this, the black parts such as the toggle clamps are "suppressed".

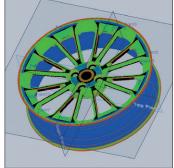

## **Visualisation**

Variances for the CAD are calculated. The 3D coordinates of the measurement points can be measured exactly and visualised in colour.

The complete 3D data set and the comparison results can be exported into common formats for further processing.



2