




Plain Clamps

Standard Manual Clam-

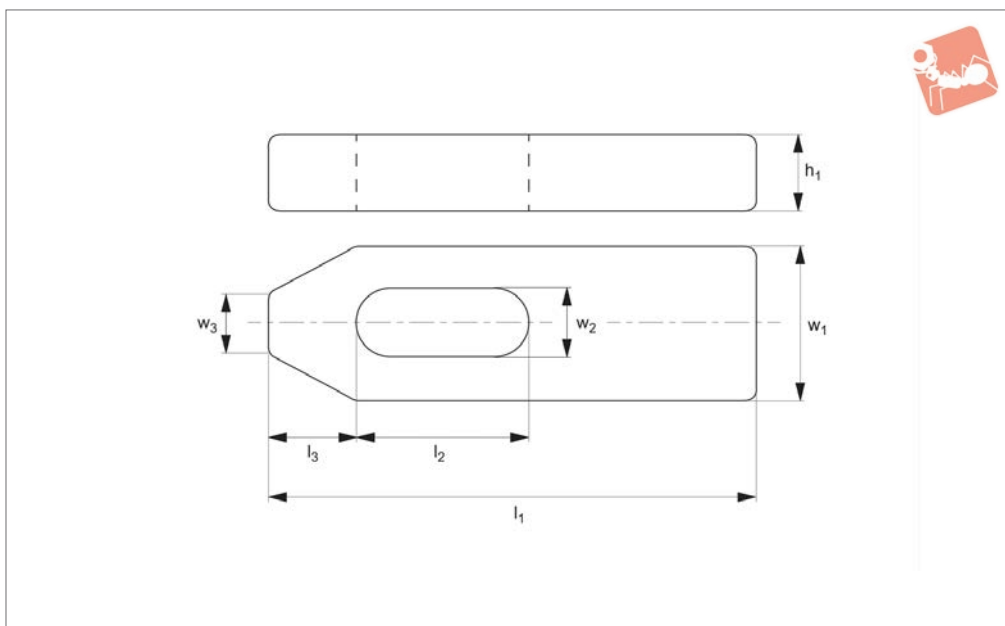

10000

STANDARD MANUAL CLAMPING

Material

Steel, heat-treated and enamelled.

() = Not to DIN standard.

collar nuts, 25000 plain washer.

Technical Notes

To DIN 6314.

Tips

Used with:

21000 T-slot bolts, 24000 T-nuts, 24400

Order No.	For bolt	For bolt inch	l_1	l_2	l_3	w_1	w_2	w_3	h_1	Weight g
10000.W0007	M 6	1/4"	50	20	10	20	6.6	8	10	63
10000.W0009	M 8	5/16"	60	22	13	25	9.0	10	12	113
10000.W0011	M10	3/8"	80	30	15	30	11.0	12	15	226
10000.W0014	M12, M14	1/2"	100	40	21	40	14.0	14	20	490
10000.W0015	M12, M14	1/2"	125	50	21	40	14.0	14	20	621
10000.W0018	M16, M18	5/8"	125	45	26	50	18.0	18	25	960
10000.W0019	M16, M18	5/8"	160	65	26	50	18.0	18	25	1240
10000.W0022	M20, M22	3/4"	160	60	30	60	22.0	22	30	1787
10000.W0023	M20, M22	3/4"	200	80	30	60	22.0	22	30	2237
10000.W0026	M24	1"	200	80	35	70	26.0	26	30	2580
10000.W0027	M24	1"	250	105	35	70	26.0	26	35	3800
10000.W0034	M30	1-1/4"	250	100	45	80	33.0	34	40	4934
10000.W0035	M30	1-1/4"	315	130	45	80	33.0	34	50	7788
10000.W0043	M36, M42	1-1/2"	400	150	100	100	(43.0)	43	60	15000

